

## PIC24FJ256GB110 Family Rev. A3 Silicon Errata

The PIC24FJ256GB110 Family Rev. A3 parts you have received conform functionally to the Device Data Sheet (DS39897B), except for the anomalies described below. Any Data Sheet Clarification issues related to the PIC24FJ256GB110 Family will be reported in a separate Data Sheet errata. Please check the Microchip web site for any existing issues.

**The following silicon errata apply only to PIC24FJ256GB110 devices with these Device/Revision IDs:**

Part Number	Device ID	Revision ID
PIC24FJ256GB110	101Fh	01h
PIC24FJ192GB110	1017h	01h
PIC24FJ128GB110	100Fh	01h
PIC24FJ64GB110	1007h	01h
PIC24FJ256GB108	101Bh	01h
PIC24FJ192GB108	1013h	01h
PIC24FJ128GB108	100Bh	01h
PIC24FJ64GB108	1003h	01h
PIC24FJ256GB106	1019h	01h
PIC24FJ192GB106	1011h	01h
PIC24FJ128GB106	1009h	01h
PIC24FJ64GB106	1001h	01h

The Device IDs (DEVID and REVID) are located at the last two implemented addresses in program memory. They are shown in hexadecimal in the format "DEVID REVID".

### 1. Module: Core (RAM Operation)

If a RAM read is performed on the instruction immediately prior to enabling Doze mode, an extra read event may occur when Doze mode is enabled. This has no effect on most SFRs and on user RAM space. However, this could cause registers which also perform some action on a read (such as auto-incrementing a pointer or removing data from a FIFO buffer) to repeat that action, possibly resulting in lost data or unexpected operation.

#### **Work around**

Avoid reading registers which perform a secondary action (e.g., UART and SPI FIFO buffers, and the RTCVAL registers) immediately prior to entering Doze mode.

If this cannot be avoided, execute a NOP instruction before entering Doze mode.

#### **Date Codes that pertain to this issue:**

All engineering and production devices.

### 2. Module: Core (BOR)

When the on-chip regulator is enabled (ENVREG tied to VDD), a BOR event may spontaneously occur under the following circumstances:

- VDD is less than 2.5V, and either:
- the internal band gap reference is being used as a reference with the A/D converter (AD1PCFG2<1> or <0> = 1) or comparators (CMxCON<1:0> = 11); or
- the CTMU or the USB module is enabled.

#### **Work around**

Limit the following activities to only those times when the on-chip regulator is not in Tracking mode (LVDIF (IFS4<8>) = 0):

- enabling the USB or CTMU modules;
- selecting the internal bandgap as a reference for the A/D converter or the comparators.

#### **Date Codes that pertain to this issue:**

All engineering and production devices.

# PIC24FJ256GB110

---

## 3. Module: JTAG (Device Programming)

The JTAGEN Configuration bit can be programmed to '0' while using the JTAG interface for device programming. This may cause a situation where JTAG programming can lock itself out of being able to program the device.

### Work around

None.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 4. Module: UART

When the UART is operating using two Stop bits (STSEL = 1), it may sample the first Stop bit instead of the second one. If the device being communicated with is one using one Stop bit in its communications, this may lead to framing errors.

### Work around

None.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 5. Module: I/O (PORTB)

When RB5 is configured as an open-drain output, it remains in a high-impedance state. The settings of LATB5 and TRISB5 have no effect on the pin's state.

### Work around

If open-drain operation is not required, configure RB5 as a regular I/O (ODCB<5> = 0).

If open-drain operation is required, there are two options:

- select a different I/O pin for the open-drain function; or
- place an external transistor on the pin, and configure the pin as a regular I/O.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 6. Module: SPI (Master Mode)

In Master mode, both the SPI interrupt flag (SPIxIF) and the SPIRBF bit (SPIxSTAT<0>) may become set one-half clock cycle early, instead of on the clock edge. This occurs only under the following circumstances:

- Enhanced Buffer mode is disabled (SPIBEN = 0); and
- the module is configured for serial data output changes on transition from clock active to clock idle state (CKE = 1)

If the application is using the interrupt flag to determine when data to be transmitted is written to the transmit buffer, the data currently in the buffer may be overwritten.

### Work around

Before writing to the SPI buffer, check the SCK pin to determine if the last clock edge has passed. Example 1 (below) demonstrates a method for doing this; in this example, pin RD1 functions as the SPI clock SCK, which is configured as idle-low.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 7. Module: CTMU

When the CTMU module is selected as the trigger source (SYNCSEL4:SYNCSEL0 = 11000), the Output Compare or Input Capture module triggers may not work.

### Work around

Manually trigger the Output Compare and/or Input Capture modules after a CTMU event is received. Be certain to compensate for any time latency required by manually triggering the module.

### Date Codes that pertain to this issue:

All engineering and production devices.

## EXAMPLE 1: CHECKING THE STATE OF SPIXIF AGAINST THE SPI CLOCK

```
while(IFSobits.SPI1IF == 0){} //wait for the transmission to complete
while(PORTDbits.RD1 == 1){} //wait for the last clock to finish
SPI1BUF = 0xFF; //write new data to the buffer
```

## 8. Module: USB

While operating in Host mode and attached to a low-speed device through a full-speed USB hub, the PRE signal may not be generated correctly. This will result in not being able to communicate correctly with the low-speed device.

### **Work around**

Connect low-speed devices directly to the application, and not through a USB hub.

### **Date Codes that pertain to this issue:**

All engineering and production devices.

## 9. Module: USB (VUSB Regulator)

The USB internal voltage regulator does not regulate to 3.3V. The USB internal voltage regulator is an optional feature and is not required for USB operation or compliance.

### **Work around**

Disable the USB voltage regulator (DISUVREG configuration bit set to '1'), and supply 3.0V to 3.6V from an external source to the VUSB pin.

### **Date Codes that pertain to this issue:**

All engineering and production devices.

## 10. Module: USB

When the module is configured to use an external transceiver, the CRC5 value of some packets may be incorrect.

### **Work around**

Use the module's internal transceiver.

### **Date Codes that pertain to this issue:**

All engineering and production devices.

## 11. Module: USB

The Bus Activity Interrupt flag, ACTVIF, is active only while the device is in Sleep mode. It will not become set when the microcontroller is in a Run mode.

### **Work around**

The type of work around depends on the type of application that the microcontroller is being used in.

**For Self-powered peripherals:** after receiving a Suspend command from the PC, do NOT suspend or disable the USB module. In addition, do not switch to a clock configuration that is incompatible with USB operation (refer to the device data sheet for USB-compatible clock settings).

**For Bus powered peripherals:** after receiving a Suspend command from the PC (IDLEIF interrupt flag = 1),

- suspend the USB module (U1PWRC<1> = 1);
- globally enable USB interrupts (IEC5<6> = 1);
- specifically enable the Bus Activity interrupt (U1OTGIE<4> = 1); and
- place the microcontroller into Sleep mode as soon as possible

### **For Embedded Host devices:**

- issue a Suspend command to the peripheral device;
- suspend the USB module (U1PWRC<1> = 1);
- globally enable USB interrupts (IEC5<6> = 1);
- place the microcontroller into Sleep mode as soon as possible

As an alternate procedure, do NOT suspend or disable the USB module, and do not switch to a clock configuration that is incompatible with USB operation.

### **Date Codes that pertain to this issue:**

All engineering and production devices.

# PIC24FJ256GB110

---

## 12. Module: UART (UERIF Interrupt)

The UART Error interrupt may not occur, or occur at an incorrect time, if multiple errors occur during a short period of time.

### Work around

Read the error flags in the UxSTA register whenever a byte is received to verify the error status. In most cases, these bits will be correct, even if the UART error interrupt fails to occur. For possible exceptions, refer to Errata # 13.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 13. Module: UART (FIFO Error Flags)

Under certain circumstances, the PERR and FERR error bits may not be correct for all bytes in the receive FIFO. This has only been observed when both of the following conditions are met:

- the UART Receive interrupt is set to occur when the FIFO is full or  $\frac{3}{4}$  full (UxSTA<7:6> = 1x), and
- more than 2 bytes with an error are received.

In these cases, only the first two bytes with a parity or framing error will have the corresponding bits indicate correctly. The error bits will not be set after this.

### Work around

None.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 14. Module: UART (IrDA®)

When the UART is operating in 8-bit mode (PDSEL1:PDSEL0 = 0x) and using the IrDA endec (IREN = 1), the module incorrectly transmits a data payload of 80h as 00h.

### Work around:

None.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 15. Module: UART (IrDA)

When the UART is operating in 8-bit mode (PDSEL1:PDSEL0 = 0x) and using the IrDA endec (IREN = 1), a framing error may occur when transmitting a data payload of 00h.

### Work around:

None.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 16. Module: UART (IrDA)

When the UART is operating in 9-bit mode (PDSEL1:PDSEL0 = 1x) and using the IrDA endec (IREN = 1), the module will incorrectly transmit 10 bits when transmitting data payloads of 00h or 80h.

### Work around:

None.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 17. Module: I<sup>2</sup>C™ Module (Master Mode)

Under certain circumstances, a module operating in Master mode may acknowledge its own command addressed to a slave device. This happens when the following occurs:

- 10-bit Addressing mode is used (A10M = 1), and:
- the I<sup>2</sup>C Master has the same two upper address bits (I2CADD<9:8>) as the addressed slave module.

In these cases, the Master also acknowledges the address command and generates an erroneous I<sup>2</sup>C Slave interrupt, as well as the I<sup>2</sup>C Master interrupt.

### Work around

Several options are available:

- When using 10-bit Addressing mode, make certain that the Master and Slave devices do not share the same 2 MSBs of their addresses.

If this cannot be avoided:

- Clear the A10M bit (I2CxCON<10> = 0) prior to performing a Master mode transmit.
- Read the ADD10 bit (I2CxSTAT<8>) to check for a full 10-bit match whenever a Slave I<sup>2</sup>C interrupt occurs on the Master module.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 18. Module: I<sup>2</sup>C Module (Slave Mode)

Under certain circumstances, a module operating in Slave mode may not respond correctly to some of the special addresses reserved by the I<sup>2</sup>C protocol. This happens when the following occurs:

- 10-bit Addressing mode is used (A10M = 1), and:
- bits A7:A1 of the Slave address (I2CADD<7:1>) fall into the range of the reserved 7-bit address ranges '1111xxx' or '0000xxx'.

In these cases, the Slave module acknowledges the command and triggers an I<sup>2</sup>C Slave interrupt; it does *not* copy the data into the I2CxRCV register, or set the RBF bit.

### Work around

Do not set bits A7:A1 of the module's Slave address equal to '1111xxx' or '0000xxx'.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 19. Module: Memory (Program Space Visibility)

When accessing data in the PSV area of data RAM, it is possible to generate a false address error trap condition by reading data located precisely at the lower address boundary (8000h). If data is read using an instruction with an auto-decrement, the resulting RAM address will be below the PSV boundary (i.e., at 7FFEh); this will result in an address error trap.

This false address error can also occur if a 32-bit MOV instruction is used to read the data at location 8000h.

### Work around

Do not use the first location of the a PSV page (address 8000h). The MPLAB C Compiler (v3.11 or later) supports the option "-merrata=psv\_trap" to prevent it from generating code that would cause this erratum.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 20. Module: ICSP™

The ICSP/ICD port pair PGEC3/PGED3 (RB5/RB4) cannot be used to read or program the device.

### Work around

Use either PGEC2/PGED2 or PGEC1/PGED1.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 21. Module: Core (Instruction Set)

If an instruction producing a Read-After-Write stall condition is executed inside a REPEAT loop, the instruction will be executed fewer times than was intended. For example, this loop:

```
repeat #0xF
inc [w1],[++w1]
```

will execute less than 15 times.

### Work around

Avoid using REPEAT to repetitively execute instructions that create a stall condition. Instead, use a software loop using conditional branches. The MPLAB C Compiler will not generate REPEAT loops that cause this erratum.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 22. Module: RTCC

Under certain circumstances, the value of the Alarm Repeat Counter (ALCFGRPT<7:0>) may be unexpectedly decremented. This happens only when a byte write to the upper byte of ALCFGRPT is performed in the interval between a device POR/BOR, and the first edge from the RTCC clock source.

### Work around

Do not perform byte writes on ALCFGRPT, particularly the upper byte.

Alternatively, wait until one period of the SOSC has completed before performing byte writes to ALCFGRPT.

### Date Codes that pertain to this issue:

All engineering and production devices.

## 23. Module: SPI (Enhanced Buffer Modes)

If the SPI event interrupt is configured to occur when the enhanced FIFO buffer is full (SISEL2:SISEL0 = 111), the interrupt may actually occur when the 7th byte is written to the buffer, instead of the 8th byte. The other Enhanced Buffer interrupts function as previously described.

### Work around

Do not use the Full-Buffer Interrupt mode. The SPITBF bit (SPIxSTAT<1>) reliably indicates when the Enhanced FIFO buffer is full, and can be polled instead of using the Full-Buffer Interrupt mode.

### Date Codes that pertain to this issue:

All engineering and production devices.

# PIC24FJ256GB110

---

## 24. Module: A/D Converter

When using PGEC1 and PGED1 to debug an application on any 64-pin devices in this family, all voltage references will be disabled. This includes Vref+, Vref-, AVdd, and AVss. Any A/D conversion will always equal 0x3FF.

<p><b>Note:</b> This issue only applies to 64-pin devices in this family (PIC24FJ256GB106, PIC24FJ192GB106, and PIC24FJ64GB106).</p>
--

### **Work around**

Use PGEC2 and PGED2 to debug any A/D functionality.

### **Date Codes that pertain to this issue:**

All engineering and production devices.

## REVISION HISTORY

### Rev A Document (2/2008)

First revision of this document. Includes silicon issues 1 (Core, RAM Operation), 2 (Core, BOR), 3 (JTAG, Programming), 4 (UART), 5 (I/O, PORTB), 6 (SPI, Master Mode), 7 (Input Capture) and 8 through 11 (USB).

### Rev B Document (7/2008)

Revised silicon issues 4 (UART) and 6 (SPI, Master Mode) to reflect updated definition of issues. Added silicon issues 12 (UART, UERIF Interrupt), 13 (UART, FIFO Error Flags), 14 through 16 (UART, IrDA), 17 (I<sup>2</sup>C, Master Mode), 18 (I<sup>2</sup>C, Slave Mode), 19 (Memory, Program Space Visibility), 20 (ICSP), 21 (Core, Instruction Set), 22 (RTCC), 23 (SPI, Enhanced Buffer Modes) and 24 (A/D Converter).

# PIC24FJ256GB110

---

NOTES:



---

**Note the following details of the code protection feature on Microchip devices:**

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

---

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

**Trademarks**

The Microchip name and logo, the Microchip logo, Accuron, dsPIC, KEELOQ, KEELOQ logo, MPLAB, PIC, PICmicro, PICSTART, rfPIC and SmartShunt are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

FilterLab, Linear Active Thermistor, MXDEV, MXLAB, SEEVAL, SmartSensor and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, dsSPEAK, ECAN, ECONOMONITOR, FanSense, In-Circuit Serial Programming, ICSP, ICEPIC, Mindi, MiWi, MPASM, MPLAB Certified logo, MPLIB, MPLINK, mTouch, PICkit, PICDEM, PICDEM.net, PICtail, PIC<sup>32</sup> logo, PowerCal, PowerInfo, PowerMate, PowerTool, REAL ICE, rfLAB, Select Mode, Total Endurance, UNI/O, WiperLock and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2008, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

**QUALITY MANAGEMENT SYSTEM**  
**CERTIFIED BY DNV**  
**== ISO/TS 16949:2002 ==**

*Microchip received ISO/TS-16949:2002 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.*



---

---

## WORLDWIDE SALES AND SERVICE

---

---

### AMERICAS

**Corporate Office**  
2355 West Chandler Blvd.  
Chandler, AZ 85224-6199  
Tel: 480-792-7200  
Fax: 480-792-7277  
Technical Support:  
<http://support.microchip.com>  
Web Address:  
[www.microchip.com](http://www.microchip.com)

**Atlanta**  
Duluth, GA  
Tel: 678-957-9614  
Fax: 678-957-1455

**Boston**  
Westborough, MA  
Tel: 774-760-0087  
Fax: 774-760-0088

**Chicago**  
Itasca, IL  
Tel: 630-285-0071  
Fax: 630-285-0075

**Dallas**  
Addison, TX  
Tel: 972-818-7423  
Fax: 972-818-2924

**Detroit**  
Farmington Hills, MI  
Tel: 248-538-2250  
Fax: 248-538-2260

**Kokomo**  
Kokomo, IN  
Tel: 765-864-8360  
Fax: 765-864-8387

**Los Angeles**  
Mission Viejo, CA  
Tel: 949-462-9523  
Fax: 949-462-9608

**Santa Clara**  
Santa Clara, CA  
Tel: 408-961-6444  
Fax: 408-961-6445

**Toronto**  
Mississauga, Ontario,  
Canada  
Tel: 905-673-0699  
Fax: 905-673-6509

### ASIA/PACIFIC

**Asia Pacific Office**  
Suites 3707-14, 37th Floor  
Tower 6, The Gateway  
Harbour City, Kowloon  
Hong Kong  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**Australia - Sydney**  
Tel: 61-2-9868-6733  
Fax: 61-2-9868-6755

**China - Beijing**  
Tel: 86-10-8528-2100  
Fax: 86-10-8528-2104

**China - Chengdu**  
Tel: 86-28-8665-5511  
Fax: 86-28-8665-7889

**China - Hong Kong SAR**  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**China - Nanjing**  
Tel: 86-25-8473-2460  
Fax: 86-25-8473-2470

**China - Qingdao**  
Tel: 86-532-8502-7355  
Fax: 86-532-8502-7205

**China - Shanghai**  
Tel: 86-21-5407-5533  
Fax: 86-21-5407-5066

**China - Shenyang**  
Tel: 86-24-2334-2829  
Fax: 86-24-2334-2393

**China - Shenzhen**  
Tel: 86-755-8203-2660  
Fax: 86-755-8203-1760

**China - Wuhan**  
Tel: 86-27-5980-5300  
Fax: 86-27-5980-5118

**China - Xiamen**  
Tel: 86-592-2388138  
Fax: 86-592-2388130

**China - Xian**  
Tel: 86-29-8833-7252  
Fax: 86-29-8833-7256

**China - Zhuhai**  
Tel: 86-756-3210040  
Fax: 86-756-3210049

### ASIA/PACIFIC

**India - Bangalore**  
Tel: 91-80-4182-8400  
Fax: 91-80-4182-8422

**India - New Delhi**  
Tel: 91-11-4160-8631  
Fax: 91-11-4160-8632

**India - Pune**  
Tel: 91-20-2566-1512  
Fax: 91-20-2566-1513

**Japan - Yokohama**  
Tel: 81-45-471- 6166  
Fax: 81-45-471-6122

**Korea - Daegu**  
Tel: 82-53-744-4301  
Fax: 82-53-744-4302

**Korea - Seoul**  
Tel: 82-2-554-7200  
Fax: 82-2-558-5932 or  
82-2-558-5934

**Malaysia - Kuala Lumpur**  
Tel: 60-3-6201-9857  
Fax: 60-3-6201-9859

**Malaysia - Penang**  
Tel: 60-4-227-8870  
Fax: 60-4-227-4068

**Philippines - Manila**  
Tel: 63-2-634-9065  
Fax: 63-2-634-9069

**Singapore**  
Tel: 65-6334-8870  
Fax: 65-6334-8850

**Taiwan - Hsin Chu**  
Tel: 886-3-572-9526  
Fax: 886-3-572-6459

**Taiwan - Kaohsiung**  
Tel: 886-7-536-4818  
Fax: 886-7-536-4803

**Taiwan - Taipei**  
Tel: 886-2-2500-6610  
Fax: 886-2-2508-0102

**Thailand - Bangkok**  
Tel: 66-2-694-1351  
Fax: 66-2-694-1350

### EUROPE

**Austria - Wels**  
Tel: 43-7242-2244-39  
Fax: 43-7242-2244-393

**Denmark - Copenhagen**  
Tel: 45-4450-2828  
Fax: 45-4485-2829

**France - Paris**  
Tel: 33-1-69-53-63-20  
Fax: 33-1-69-30-90-79

**Germany - Munich**  
Tel: 49-89-627-144-0  
Fax: 49-89-627-144-44

**Italy - Milan**  
Tel: 39-0331-742611  
Fax: 39-0331-466781

**Netherlands - Drunen**  
Tel: 31-416-690399  
Fax: 31-416-690340

**Spain - Madrid**  
Tel: 34-91-708-08-90  
Fax: 34-91-708-08-91

**UK - Wokingham**  
Tel: 44-118-921-5869  
Fax: 44-118-921-5820